



**Consumer Response Group**

6500 W. Cortland Street \* Chicago, IL 60707 \* Phone: 773-889-8870 \* FAX: 773-622-2269

---

October 21, 2010

Page 1 of 3

# TECHNICAL SERVICE BULLETIN

## 10072

**MODEL(S):** 29 LX LE

**DESCRIPTION:** No display

**ACTION:** There is a ribbon cable which runs from the display to the display PCB. If this cable becomes loose then you may loose the display. Or the display may become intermittent.

Please note that this is not a defect.

The only time that this problem has been encountered is when someone has opened the radio to poke around inside, and the ribbon cable was inadvertently disturbed.

The following pages shows the location of the ribbon cable. Make sure that the cable is fully seated into the connector. Please note that the connector has a locking mechanism. Lift up on the top piece to release the lock, and push back down to engage the lock.

1. Lift up on the top piece to release the lock (see page 3).
2. Use the eraser end of a pencil to push the ribbon cable all the way down.
3. Push down on the top piece to engage the lock.

**ADJUSTMENTS:** None

**NOTES:** None



