

E. F. JOHNSON COMPANY

CITIZENS RADIO  
#CB-29  
May 26, 1969

--- SERVICE BULLETIN ---

EQUIPMENT AFFECTED

Messenger 123, Model 242-0123-001

REASON FOR REVISION

The receiver in some units may be inoperative due to loss of injection voltage at Q2 base.

REVISION

Change R31 resistor to a value of 10K ohms, JOHNSON #569-1004-103, when using Motorola series MSPS 3375 transistors for Q14, JOHNSON #576-0001-013.

PARTS REQUIRED

<u>QUANTITY</u>	<u>PART NO.</u>	<u>DESCRIPTION</u>
1	576-0001-013	Transistor, 1013
1	569-1004-103	Resistor, 10K, $\pm 10\%$ 1/2 watt

SUMMARY

These changes will be found in some "B" models and later models.