



EQUIPMENT AFFECTED

Johnson Hi/Lo Duo Scan,[®] Part No. 241-0390-xxx
Johnson UHF/VHF Duo Scan,[®] Part No. 241-0391-xxx
Johnson VHF Mono Scan,[™] Part No. 241-0392-xxx
Johnson UHF Mono Scan,[™] Part No. 241-0393-xxx

REASON FOR REVISION

Due to a manufacturing defect in the pilot lamp filament (failure to trim the filament wire) a short may occur which generates noise into the scanner receiver. This noise pulse may cause various problems, the most common of which is that the receiver locks onto the channel with a defective light bulb.

REVISION

A defective bulb may be recognized by a dim glow, or a filament configuration similar to that shown in Figure 1.

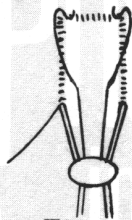


Figure 1

PARTS REQUIRED

<u>QTY</u>	<u>PART NUMBER</u>	<u>PART DESCRIPTION</u>
1-8	549-3001-003	Pilot lamp 14.4 V, clear

CHANGE ACTION

Change noisy lamps as necessary.