



EQUIPMENT AFFECTED

Messenger 130, Part No. 242-0130-001

REASON FOR REVISION

Eliminate the squeal when transmitting caused by RF feedback from antenna to handset cable.

REVISION

Solder one end of C101, a 0.001 μ F capacitor, to pin 1 of TB1, the terminal with the black lead. Solder the other lead of C101 to the chassis.

PARTS REQUIRED

<u>QTY</u>	<u>PART NUMBER</u>	<u>PART DESCRIPTION</u>
1	510-3061-102	1000 pF \pm 20% 1KV Y5S

CHANGE ACTION

Make this change as necessary. This change will be included in "A" model transceivers built after April, 1974.