- 1. Remove R-22 100K -- ristor.
- 2. Remove D3 and replace with 20 Pf.
- 3. Remove C+-1 20 Pf trimmer.
- 4. Remove clarifier control replace with 2 30Pf variable. Cap in its place.
- 5. Make a choke or by a JW miller part #4204 5-12 mh Rf choke.
- 6. Ground one side of cap the choke is soldered on the cap and the other side of the choke gos to the place were the C+-1. trimmer was removed. This will allow 20 + KHz slide.

## COBRA 78X

10.240 Regular Channels


10.412 Up 27.415 - 27.865

10.071 Down 26.955 - 26.625

VR6 - Adjust for Max Mod.

L12 & L15 - Peak for max mod.

Do not adjust L18 this is your TVI trap and miss tuning will cause blead over and cross mod on TV. If this slug has been tuned and you do not have a Spectrum Analyzer you may use Channel 2 on a TV and tune for minimum interference.

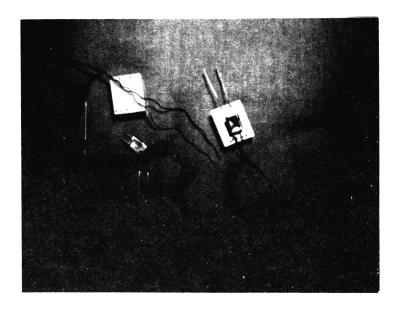

TYPICAL RELAY MODULE