
. . Set-up Diagram . .

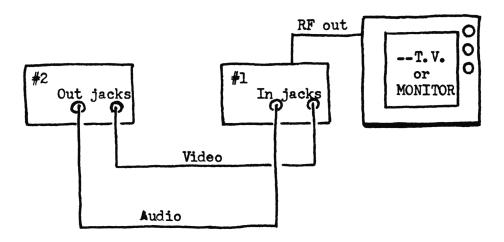

Another note on these cables is: not CHEAP, but worth the cost!

\$9.88 for 6' and \$10.22 for 10' - EACH! Don't bundle up after
buying them; stretch out flat for couple of days; store when not
in use in a wide loop, and in large sealable plastic bag.

Are best investment you could make for use with your VCR....

*We can supply these on special order, but do not stock at
present time. If demand is sufficient, will in the future....

SPECIFIC TUNE-UPS

Sears 934.38060700 (861 PLL)... Use SAMS-236, 934.38062700

Be careful working on this unit - the slugs in TX section have square holes and very easily broken....

TX - Peak Tll, Tl2, Tl3, Tl4, Tl5

RT-1, Mixer Gain

RT-2, S Meter adjust

*There is no AMC adjust; remove D-7; replace with solid buss wire.

If final is blown - don't skimp - replace with 2SC1306:

Midland 1001 (77-001) and Midland 103M (77-103) IC7131-PIL

TX - Peak I205, I-204, I-206, I-207, I-203

RX - I101, I102, I103, I104

RV102 - S Meter adjust. RV103 - Squelch Range adjust

RV202 - RF Meter adjust. RV201 - Modulation adjust (Q106-defeat)

^{*} SELMAN ENTERPRISES